Handwheels • DIN 950 grey cast iron

24580.0205



Product Description

Hub machined; rim turned and mirror-finished on all sides, non-machined surfaces cleanly blasted.

Material

Handwheel

· Grey cast iron GG

Machine handle DIN 98 EH 24460. rotating

Steel, turned, zinc-plated by galvanization, passivated

Assembly


Shaft-end washers EH 22270. for axial fastening.

More information

Further products

- · Shaft-End Washers
- Rotating Machine Handles, DIN 98

Drawing

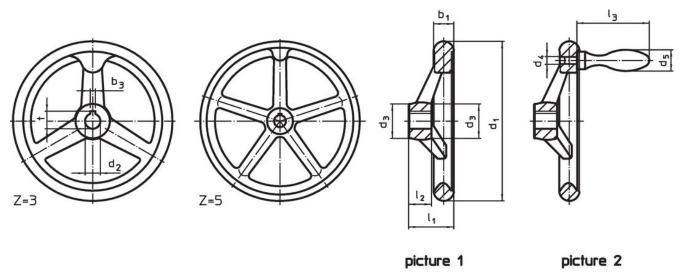

The orientation of the hub keyway may be different than shown in the drawing.

Order information


| Dimensions | | | | | | | | Number of spokes | Corresponding machine handle | Ĭ | Art. No. |
|---|-----------------|----------------|----------------|----|------------------|----------------|------------------|------------------|------------------------------|-----|------------|
| d ₁ | d₂ H7 | d ₃ | d ₄ | d₅ | l ₁ ~ | l ₂ | l ₃ ~ | z | DIN 39 / DIN 98 | | |
| [mm] | | | | | | | | | [mm] | [g] | |
| without hub keyway, with rotating handle EH 24460., assembled form B-F/G (formerly D 4) – picture 2 | | | | | | | | | | | |
| 100 | 10 | 26 | M6 | 16 | 33 | 17 | 49 | 3 | 16 | 550 | 24580.0205 |



Halder France SAS www.halder.fr Pag

Page 1 of 2 Published on: 4.2.2024

Application example

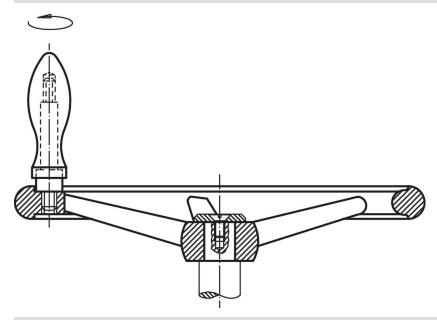

Compliance

RoHS compliant

Contains lead - compliant according to exceptions 6a / 6b / 6c.

Contains SVHC substances >0,1% w/w

Contains lead - SVHC list [REACH] as of 23.01.2024.

Contains Proposition 65 substances



Lead can cause cancer and reproductive harm from exposure https://www.P65Warnings.ca.gov/

Free from Conflict Minerals

This product does not contain any substances designated as "conflict minerals" such as tantalum, tin, gold or tungsten from the Democratic Republic of Congo or adjacent countries.



Halder France SAS www.halder.fr Page 2 of 2

Published on: 4.2.2024